



**V. M. ENGINEERING WORKS VME - 5 TON  
FIVE TONNE TIPPING TRACTOR TRAILER**



भारत सरकार

Government of India

कृषि एवं किसान कल्याण मंत्रालय

Ministry of Agriculture and Farmers Welfare

कृषि, सहकारिता एवं किसान कल्याण विभाग

Department of Agriculture, Cooperation and Farmers Welfare

दक्षिणी क्षेत्र कृषि मशीनरी प्रशिक्षण एवं परीक्षण संस्थान

Southern Region Farm Machinery Training and Testing Institute

ट्रैक्टर नगर, गार्लदिन्ने - 515 731, जिला: अनंतपुर (आं. प्र.)

Tractor Nagar, Garladinne- 515 731, District: Anantapur (A.P.)

[An ISO 9001:2015 CERTIFIED INSTITUTE]

Website: <http://srfmtti.dacnet.nic.in/>

E-mail: [fmti-sr@nic.in](mailto:fmti-sr@nic.in)

Tele./FAX: 08551-286441

<b>T-39/1070</b>	<b>V. M. ENGINEERING WORKS VME - 5 TON FIVE TONNE TIPPING TRACTOR TRAILER</b>	<b>COMMERCIAL (ICT)</b>
------------------	---	-----------------------------

Manufacturer : M/s. V.M. Engineering Works,  
371/170, Chennai Road,  
Krishnagiri, Tamil Nadu - 635 001, **India.**

Applicant : The manufacturer

V. M. ENGINEERING WORKS VME - 5 TON FIVE TONNE TIPPING TRACTOR TRAILER  
Report No. : T-39/1070                      Month: September                      Year: 2019



**Government of India**  
**Ministry of Agriculture and Farmers Welfare**  
**Department of Agriculture, Cooperation and Farmers Welfare**  
**Southern Region Farm Machinery Training and Testing Institute**  
**Tractor Nagar, Garladinne- 515 731, District: Anantapur (A.P.)**  
**[An ISO 9001:2015 CERTIFIED INSTITUTE]**

<b>T-39/1070</b>	<b>V. M. ENGINEERING WORKS VME - 5 TON FIVE TONNE TIPPING TRACTOR TRAILER</b>	<b>COMMERCIAL (ICT)</b>
------------------	---	-----------------------------

## **9. EASE OF OPERATION & ADJUSTMENTS**

No difficulty was observed during the operation and adjustment of Trailer.

## **10. DEFECTS, BREAKDOWNS AND REPAIRS**

No defect/breakdown and repair was occurred during entire period of testing.

## **11. SUMMARY OF OBSERVATIONS, COMMENTS AND RECOMMENDATION**

- 11.1 To protect from mud and soil the rubber flaps are provided at rear end of the wheels.
- 11.2 Dimensional requirements of single axle (semitrailer) conform to IS 8213:2000.
- 11.3 Reflectors are not provided on trailer as per IS 8213:2000. This should be looked into for corrective action.
- 11.4 The specification of trailer does not conform in full, to the IS 8213:2000. This should be looked into for corrective action.
- 11.5 The dimensions of hydraulic tipping cylinder does not meet, in full to the requirement of IS 12371:1988. This should be taken into for corrective action
- 11.6 The dimensions of ring does not meet, in full, the requirement of IS 11270:1980 (Reaffirmed 1999). This should be taken into for corrective action.
- 11.7 The dimensions of various components of axle assembly do not conform, in full, the requirement of IS 8213:2000. This should be taken into for corrective action.
- 11.8 Labeling plate should be provided as per the requirement of IS.

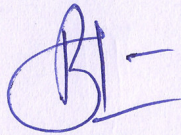
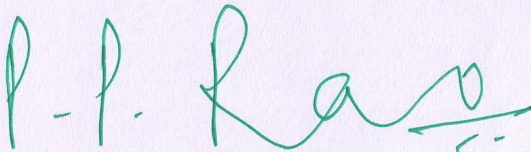


T-39/1070	V. M. ENGINEERING WORKS VME - 5 TON FIVE TONNE TIPPING TRACTOR TRAILER	COMMERCIAL (ICT)
-----------	---	---------------------

### 11.9 Adequacy of literature:

Operation manual, Service manual, and parts catalogue of trailer in English was provided in single booklet form for reference during the test. However, this may be brought out in Hindi and other regional languages as per IS 8132: 1999 (Reaffirmed 2004) for the sake of user & technical personnel.

### TESTING AUTHORITY:

B.N. DIXIT AGRICULTURAL ENGINEER	
Dr. P.P. RAO DIRECTOR	

### 12. APPLICANT COMMENTS

"All the suggestions are noted. And we will make all possible necessary changes in future production".