

व्यावसायिक परीक्षण रिपोर्ट (प्रारंभिक)  
COMMERCIAL TEST REPORT (ICT)

संख्या/No: TT/SRFMTTI,  
ANANTAPUR/2025-26/24/24/1961  
माह/Month: December, 2025

THIS TEST REPORT IS VALID UP TO 30.11.2032



RAM TRAILER, RAM-T-5T TRACTOR TRAILER



भारत सरकार

Government of India

कृषि एवं किसान कल्याण मंत्रालय

Ministry of Agriculture and Farmers Welfare

कृषि एवं किसान कल्याण विभाग

Department of Agriculture and Farmers Welfare

दक्षिणी क्षेत्र कृषि मशीनरी प्रशिक्षण एवं परीक्षण संस्थान

Southern Region Farm Machinery Training and Testing Institute

ट्रैक्टर नगर, गार्लदिन्ने - 515 731, जिला: अनंतपुर (आं. प्र.)

Tractor Nagar, Garladinne- 515 731, District: Anantapur (A.P.)

[An ISO 9001:2015 CERTIFIED INSTITUTE]

Website: <http://srfmtti.dacnet.nic.in/>

E-mail: [fmti-sr@nic.in](mailto:fmti-sr@nic.in)

TT/SRFMTTI, ANANTAPUR/2025-26/ 24/24/1961	RAM TRAILER, RAM-T-5T TRACTOR TRAILER	COMMERCIAL (IC) 515 731
	THIS TEST REPORT IS VALID UPTO 30.11.2032	

Manufacturer : M/s. Ram Agro Machinery,  
At Post-Mahan Road, Pinjar Tq Barshitakli,  
Dist- Akola, Maharashtra- 444407, India.

Applicant : The Manufacturer.

### RAM TRAILER, RAM-T-5T TRACTOR TRAILER

Report No.: TT/SRFMTTI, ANANTAPUR/2025-26/24/24/1961

Month: December

Year: 2025



सत्यमेव जयते

**Government of India**  
**Ministry of Agriculture and Farmers Welfare**  
**Department of Agriculture and Farmers Welfare**  
**Southern Region Farm Machinery Training and Testing Institute**  
**Tractor Nagar, Garlandinne- 515 731, District: Anantapur (A.P.)**  
**[An ISO 9001:2015 CERTIFIED INSTITUTE]**

Website: <http://srfmtti.dacnet.nic.in/>

E-mail: [fmti-sr@nic.in](mailto:fmti-sr@nic.in)



<b>RAM TRAILER, RAM-T-5T TRACTOR TRAILER</b>	<b>COMMERCIAL (ICT)</b>
<b>THIS TEST REPORT IS VALID UPTO 30.11.2032</b>	

Type of test : COMMERCIAL (ICT)

Period of test : November, 2025

Test Report No. : **TT/SRFMTTI, ANANTAPUR/2025-26/24/24/1961**

Month / Year of release : December, 2025

- i) The results reported in this report are observed values and no corrections have been applied for atmospheric and site conditions.
- ii) The test sample was selected randomly through virtual mode by institute. The results presented in this report do not, in any way, attribute to the
- iii) durability of the machine.
- iv) This report should not be reproduced in part or full without prior permission of the Director, Southern Region Farm Machinery Training and Testing Institute, Garladinne, Anantapur (A.P.).
- v) This is a report on Commercial Test of tractor trailer name "**RAM TRAILER, RAM-T-5T TRACTOR TRAILER**". This report is valid up to **30.11.2032, Vide Ministry's O.M. No. 13-22/2020-M&T (I&P) dated 12.12.2023.**

**SELECTED CONVERSIONS**

S. No	Units	Conversion Factor
<b>1</b>	<b>Force</b>	
	1 kgf	9.80665 N
		2.20462 lbf
<b>2</b>	<b>Power</b>	
	1 hp	1.01387 metric hp (Ps)
		745.7 W
	1 Ps	735.5 W
	1 kW	1.35962 Ps
<b>3</b>	<b>Pressure</b>	
	1 psi	6.895 kPa
	1 kgf/cm <sup>2</sup>	98.067 kPa = 735.56 mm of Hg
	1 bar	100 kPa = 10 N/cm <sup>2</sup>
	1 mm of Hg	1.3332 m-bar



TT/SRFMTTI, ANANTAPUR/2025-26/ 24/24/1961	RAM TRAILER, RAM-T-5T TRACTOR TRAILER THIS TEST REPORT IS VALID UPTO 30.11.2032
---	--

## 12. SUMMARY OF OBSERVATIONS, COMMENTS AND RECOMMENDATION

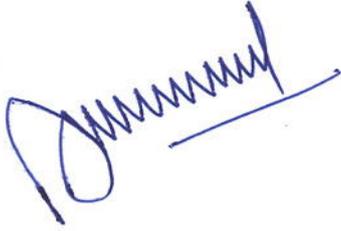
- 12.1** Lighting arrangement for trailer is not provided as per IS 8213:2000 (Reaffirmed 2020). This should be looked into for corrective action.
- 12.2** The dimensions of hydraulic tipping cylinder do not meet, in full, to the requirement of IS 12371:1988 (Reaffirmed 2019). This should be looked into for corrective action.
- 12.3** The dimensions of ring type hitch does not meet, in full, the requirement of IS 11270:1985 (Reaffirmed 2019). This should be looked into for corrective action.
- 12.4** The dimension of various components of axle assembly does not conform, in full, the requirement of IS 8213:2000 (Reaffirmed 2020). This should be looked into for corrective action.
- 12.5** The trailer must be provided spring suspension (As per IS 1135:2018) for recommended load carrying capacity. This should be looked into for corrective action.
- 12.6** The Rims are not conforming to IS 13154 and 10694(part 6). This should be looked into for corrective action.
- 12.7** The braking arrangement of trailer is not provided as per IS 8213:2000 (Reaffirmed 2020). This should be looked into for corrective action.
- 12.8** The lubrication required parts shall be provided with suitable arrangement which should be easily accessible and indicated with symbols as per IS 6283(part I), this should be looked into for corrective action.
- 12.9** Slow moving emblem, T sign, Blow lamps, dust cover, two brake operated stop light, and two turn indicators should be provided on the trailer. This should be looked into for corrective action.

TT/SRFMTTI, ANANTAPUR/2025-26/ 24/24/1961	RAM TRAILER, RAM-T-5T TRACTOR TRAILER	COMMERCIAL (ICT)
	THIS TEST REPORT IS VALID UPTO 30.11.2032	

**12.10 Adequacy of literature:**

Service manual and parts catalogues of trailer were provided in english only. However, it is recommended that same may be brought out in Hindi and regional languages and accordance with IS 8213:2000 (Reaffirmed 2020) for the sake of user & technical personnels.

**TESTING AUTHORITY**

 Er. PRAMOD YADAV AGRICULTURALENGINEER	 Er. Y K RAO SENIOR AGRICULTURAL ENGINEER
 Dr. P.P. RAO DIRECTOR	