

व्यावसायिक परीक्षण रिपोर्ट (प्रारंभिक)
COMMERCIAL TEST REPORT
(INITIAL)

संख्या / No: T-28/1043
माह / Month: July, 2019
Validity: 30.06.2026



**DHARMA AGRO INDUSTRIES DAI - 05 FIVE TONNE
TRACTOR TRAILER**



भारत सरकार

Government of India

कृषि एवं किसान कल्याण मंत्रालय

Ministry of Agriculture and Farmers Welfare

कृषि, सहकारिता एवं किसान कल्याण विभाग

Department of Agriculture, Cooperation and Farmers Welfare

दक्षिणी क्षेत्र कृषि मशीनरी प्रशिक्षण एवं परीक्षण संस्थान

Southern Region Farm Machinery Training and Testing Institute

ट्रैक्टर नगर, गार्लदिन्ने - 515 731, जिला: अनंतपुर (आ. प्र.)

Tractor Nagar, Garladinne- 515 731, District: Anantapur (A.P.)

[An ISO 9001:2015 CERTIFIED INSTITUTE]

Website: <http://srfmtti.dacnet.nic.in/>

E-mail: fmti-sr@nic.in

Tele./FAX: 08551-286441

T-28/1043	DHARMA AGRO INDUSTRIES DAI - 05 FIVE TONNE TRACTOR TRAILER	COMMERCIAL (ICT)
------------------	---	-----------------------------

Manufacturer : M/s. Dharma Agro Industries,
Behind Mahindra Tractor Showroom, Opp.
Ravi Mill, P.B. Road, Davanagere - 577 004,
Karnataka, **India.**

Applicant : The Manufacturer

DHARMA AGRO INDUSTRIES DAI - 05 TONNE TRACTOR TRAILER

Report No. : T-28/1043

Month: July

Year: 2019



Government of India
Ministry of Agriculture and Farmers Welfare
Department of Agriculture, Cooperation and Farmers Welfare
Southern Region Farm Machinery Training and Testing Institute
Tractor Nagar, Garladinne- 515 731, District: Anantapur (A.P.)
[An ISO 9001:2015 CERTIFIED INSTITUTE]

Telephone No. 08551-286441
Website: <http://srfmtti.dacnet.nic.in/>

Fax No.08551-286441
E-mail: fmti-sr@nic.in

T-28/1043	DHARMA AGRO INDUSTRIES DAI - 05 FIVE TONNE TRACTOR TRAILER	COMMERCIAL (ICT)
------------------	---	-----------------------------

9. EASE OF OPERATION & ADJUSTMENTS

No difficulty was observed during the operation and adjustment of Trailer.

10. DEFECTS, BREAKDOWNS AND REPAIRS

No defect/breakdown and repair was occurred during entire period of testing.

11. SUMMARY OF OBSERVATIONS, COMMENTS AND RECOMMENDATION

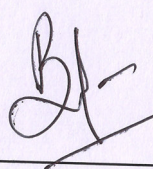
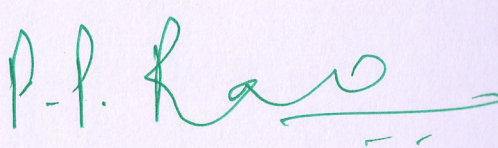
- 11.1 To protect from mud and soil the rubber flaps are provided at rear end of the wheels.
- 11.2 Dimensional requirements of single axle (semitrailer) conforms to IS 8213:2000.
- 11.3 The specification of trailer does not conform in full, to the IS 8213:2000. This should be looked into for corrective action.
- 11.4 The dimensions of hydraulic tipping cylinder does not meet, in full to the requirement of IS 12371:1988. This should be taken into for corrective action.
- 11.5 The dimensions of ring does not meet, in full, the requirement of IS 11270:1985 (Reaffirmed 1999). This should be taken into for corrective action.
- 11.6 The dimensions of various components of axle assembly do not conform, in full, the requirement of IS 8213:2000. This should be taken into for corrective action.
- 11.7 Lighting arrangement of trailer is not provided as per IS 8213:2000. This should be taken into for corrective action.
- 11.8 Labeling plate should be provided as per the requirement of IS.

T-28/1043	DHARMA AGRO INDUSTRIES DAI - 05 FIVE TONNE TRACTOR TRAILER	COMMERCIAL (ICT)
-----------	---	---------------------

11.9 Adequacy of literature:

Operation manual, Service manual, and parts catalogue of trailer in English was provided in single booklet form for reference during the test. However, this may be brought out in Hindi and other regional languages as per IS 8132: 1999 (Reaffirmed 2004) for the sake of user & technical personnel.

TESTING AUTHORITY:

B.N. DIXIT AGRICULTURAL ENGINEER	
Dr. P.P. RAO DIRECTOR	

12. APPLICANT'S COMMENTS

"We will make all possible necessary changes in future production".