

व्यावसायिक परीक्षण रिपोर्ट (प्रारंभिक)  
COMMERCIAL TEST REPORT  
(INITIAL)

संख्या / No: T-44/1106  
माह / Month: January, 2020  
Validity: 31.12.2026



**OM GANESH AGRO INDUSTRIES OGAI-03T  
THREE TONNE TIPPING TRACTOR TRAILER**



भारत सरकार  
Government of India  
कृषि एवं किसान कल्याण मंत्रालय  
Ministry of Agriculture and Farmers Welfare  
कृषि, सहकारिता एवं किसान कल्याण विभाग  
Department of Agriculture, Cooperation and Farmers Welfare  
दक्षिणी क्षेत्र कृषि मशीनरी प्रशिक्षण एवं परीक्षण संस्थान  
Southern Region Farm Machinery Training and Testing Institute  
ट्रैक्टर नगर, गार्लदिन्ने - 515 731, जिला: अनंतपुर (आं. प्र.)  
Tractor Nagar, Garladinne- 515 731, District: Anantapur (A.P.)  
[An ISO 9001:2015 CERTIFIED INSTITUTE]

Website: <http://srfmtti.dacnet.nic.in/>  
E-mail: [fmti-sr@nic.in](mailto:fmti-sr@nic.in)

Tele./FAX: 08551-286441

<b>T-44/1106</b>	<b>OM GANESH AGRO INDUSTRIES OGAI-03T THREE TONNE TIPPING TRACTOR TRAILER</b>	<b>COMMERCIAL (ICT)</b>
------------------	---	-----------------------------

Manufacturer : M/s. Om Ganesh Agro Industries,  
A.P.M.C Main Road, Near KSRTC Bus stop,  
Davangere-577003, Karnataka, **India**

Applicant : The Manufacturer

---

Om Ganesh Agro Industries OGAI-03T Three Tonne Tipping Tractor Trailer  
Report No. : T-44/1106      Month: January      Year: 2020



**Government of India**  
**Ministry of Agriculture and Farmers Welfare**  
**Department of Agriculture, Cooperation and Farmers Welfare**  
**Southern Region Farm Machinery Training and Testing Institute**  
**Tractor Nagar, Garladinne- 515 731, District: Anantapur (A.P.)**  
**[An ISO 9001:2015 CERTIFIED INSTITUTE]**

Telephone: 08551-286441

Fax: 08551-286441

<b>SOUTHERN REGION FARM MACHINERY TRAINING &amp; TESTING INSTITUTE, ANANTAPUR, (A.P.)</b>	<b>Page 2 of 29</b>
---	---------------------

<b>T-44/1106</b>	<b>OM GANESH AGRO INDUSTRIES OGAI-03T THREE TONNE TIPPING TRACTOR TRAILER</b>	<b>COMMERCIAL (ICT)</b>
------------------	---	-----------------------------

## **11. SUMMARY OF OBSERVATIONS, COMMENTS AND RECOMMENDATION**

- 11.1 To protect from mud and soil the rubber flaps are provided at rear end of the wheels.
  
- 11.2 Dimensional requirements of single axle (semitrailer) conforms to IS 8213:2000.
  
- 11.3 The lightening arrangement of trailer is not provided as per IS 8213:2000. This should be looked into for corrective action.
  
- 11.4 The specification of trailer does not conform in full, to the IS 8213:2000. This should be looked into for corrective action.
  
- 11.5 The dimensions of hydraulic tipping cylinder does not meet, in full to the requirement of IS 12371:1988. This should be taken care for corrective action
  
- 11.6 The dimensions of ring does not meet, in full, the requirement of IS 11270:1980 (Reaffirmed 1999). This should be taken care for corrective action.
  
- 11.7 The dimensions of various components of axle assembly do not conform, in full, the requirement of IS 8213:2000. This should be looked into for corrective action.
  
- 11.8 The provided labeling plate should be as per the requirement of IS.

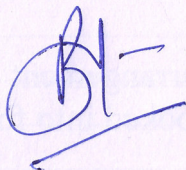



<b>T-44/1106</b>	<b>OM GANESH AGRO INDUSTRIES OGAI-03T THREE TONNE TIPPING TRACTOR TRAILER</b>	<b>COMMERCIAL (ICT)</b>
------------------	---	-----------------------------

11.9 Adequacy of literature:

Operation manual, Service manual, maintenance manual and parts catalogue of trailer in English was provided in single booklet form for reference during the test. However, this may be brought out in Hindi and other regional languages as per IS 8132: 1999 (Reaffirmed 2004) for the sake of user & technical personnel.

TESTING AUTHORITY:

B.N. DIXIT AGRICULTURAL ENGINEER	
Dr. P.P. RAO DIRECTOR	

12. APPLICANT'S COMMENTS

As per your recommendations we will try to improve our trailer in future.